

# **ST01** SOIL TEMPERATURE SENSOR

ST01 is a high quality temperature sensor that is specifically designed for soil temperature measurement in extreme environments. Using top quality materials it is suitable for hostile conditions as encountered in outdoor installation (temperature, radiation, chemicals). It is designed to have a record-breaking lifetime with optimal stability. Employing a platinum sensor, at extreme temperatures a higher accuracy can be attained than with commonly used thermistors.

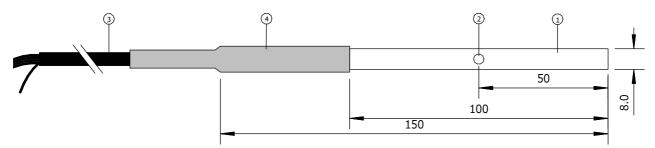


Figure 1 ST01 Soil Temperature Sensor: The sensor consists of a stainless steel needle (1) with a temperature sensor (2) (normally Pt100, also Pt500 and Pt1000 available). The Pt elements are connected in a 4-wire configuration. The PTFE cabling (3) is welded (4) to the stainless steel. All dimensions are in mm.

## INTRODUCTION

The measurement of soil temperature is recommended by the World Meteorological Organisation at depths of 5, 10, 20, 50 and 100 cm. Proper installation of soil temperature sensors requires a lot of effort. Once installed, sensors are usually left alone without calibration for a long time. This means that the sensor and cabling should be very reliable and stable over time. ST01 is designed to be an ultra-stable sensor that can withstand the extreme conditions met in meteorological use; partially sub-soil, partially above-soil installation.

#### ST01 DESIGN

The ST01 cable as well as the sensor itself can be used across a very wide temperature range. The usual weak points of cabling have been eliminated; ST01 has a high resistance to the combination of high moisture & radiation and does not crack when bended at low temperatures. The needle and cable are resistant to virtually all chemicals, oils and fluids. The preference for Pt elements is because of their excellent stability (as opposed to thermistors that are known to behave unstably in case of thermal shock and exposure to temperatures higher than 80 degrees). Also the linearity of the Pt elements is such that the initial acuracy at extreme temperatures is much better than that of thermistor based sensors; + / - 0.25 °C between -50 and +50 °C . A one-point calibration in ice is usually sufficient as general quality assurance and to increase the accuracy to +/- 0.15 °C.

## SUGGESTED USE

• Extreme environments: arctic & desert regions, polluted soil

# **MORE INFORMATION / OPTIONS**

Alternative designs: Alternative models are manufactured on request. See also model STP01. *Cable extension:* ST01 can be ordered with extended cable. Delivery times are significantly longer than with standard cable length. *Manual:* free of charge as a PDF file via e-mail.

#### **ST01 SPECIFICATIONS**

Standard sensor:	Pt100, IEC
	751:1983 class A
Alternative sensors:	Pt500, Pt1000
Measurement range:	-60 to +150 <sup>0</sup> C,
	cable remaining
	flexible
Attainable accuracy:	+ / - 0.25 °C
	+ / - 0.15 °C with
	individual calibration
	( both across -50 to
	+50 °C)
Moisture protection needle	
and cable until wiring exit:	IP 68
Pressure resistance:	6 bar
UV resistance:	no UV degradation
Standard cable length:	3m
Expected lifetime:	>10 yrs (normal
	field conditions)
Cable material:	extruded PTFE

Version 1217 (page 1 of 1) Hukseflux reserve the right to alter specifications without prior notice **HUKSEFLUX**<sup>™</sup> THERMAL SENSORS . <u>WWW.HUKSEFLUX.COM</u> . INFO@HUKSEFLUX.COM